Customer:	PRINCETON PLASMA PHY	YSICS LAB		
	Mike Viola			e: 609-243-3655
E-Mail:	mviola@pppl.gov		Fa	x: 609-243-3248
Part:			Customer P.C	.: S005243-F/Ln:7
Drawing ID:	SE120-004	Revision: 2	Qt	y: (all std. CF blanks)
Reported By:	DOUG MCCORKLE			e: 317-636-6433
E-Mail:	dMcCorkle@MajorTool.com		Fa	x: 317-634-9420
	IT WAS REQUIRED TO OVERSIZE HOLE PATTERN ON MAJORITY OF ALL ROUND BLANK COVERS .015 DIAMETER FROM ORIGINAL HOLE SIZE TO ALLOW FOR PROPER BOLT CLEARANCE. ONLY PARTIAL QTY ON LOT 7 OR 1 HAS BEEN OVERSIZED AT THIS POINT.			
Proposed Disposition: In order to provide adequate clearance for assembling the MDC covers (original specification) to the Trinos flanges (replacements for the original specified MDC flanges), it was necessary to machine the bolt holes of the flanges oversize by approximately 0.010-0.020". Also, the O.D. of the standard copper seals obtained from MDC had to be turned smaller by approximately 0.03-0.04" (on diameter). Propose "use as is" disposition. NC Type: Notification Only.				
Number of additional pages:				
Customer Dispo	osition: [X] Use As Is	[] Rework	[]Repair []Scrap	[] Replace
	See attached			
Technical Contact Approval:			Title:	Date:
Buyer Approval:			Title:	Date:
Major Tool Implemented By:			Title:	Date:

Nonconformance Report: Major Tool NC19116

This is for SE120-004

Problem:

IT WAS REQUIRED TO OVERSIZE HOLE PATTERN ON MAJORITY OF ALL ROUND BLANK COVERS .015 DIAMETER FROM ORIGINAL HOLE SIZE TO ALLOW FOR PROPER BOLT CLEARANCE. ONLY PARTIAL QTY ON LOT 7 OR 1 HAS BEEN OVERSIZED AT THIS POINT.

In order to provide adequate clearance for assembling the MDC covers (original specification) to the Trinos flanges (Replacements for the original specified MDC flanges), it was necessary to machine the bolt holes of the flanges oversize by approximately 0.010-0.020". Also, the O.D. of the standard copper seals obtained from MDC had to be turned smaller by approximately 0.03-0.04" (on diameter). Propose "use as is" disposition.

Project Disposition:

Use as is.

Additional remarks:

Does this Change Impact Material Already Procured or Parts/Assemblies Already Assembled/Manufactured using this Material: 🛛 Yes 🗌 No

If "Yes", what is the recommended disposition of this material/part/assembly?

Return rejected MDC flanges to PPPL with the first VVSA

Approvals:

Procurement Technical Representative

Responsible Line Manager:

0

Project Quality Assurance: