
Customer: PRINCETON PLASMA PHYSICS LAB

Contact: Mike Viola
E-Mail: mviola@pppl.gov

Telephone: 609-243-3655
Fax: 609-243-2021

Part: /

Drawing ID: SE120-004

Revision: 2

Customer P.O.: S005243-F/Ln:1
Serial No./Qty: VVSA # 1

Reported By: DOUG MCCORKLE
E-Mail: dMcCorkle@MajorTool.com

Telephone: 317-636-6433
Fax: 317-634-9420

Problem: The port 15 a and b is out of positional tolerance.

The port 15a checks 1.148 position and the face runs out from -0.413 / -0.327.

The port 15b checks 0.747 position and the face runs out from -0.172 / -0.108.

Proposed Disposition:

Corresponding point cloud inspection data uploaded to PPPL ftp site 04May2006.

Number of additional pages: _____

Customer Disposition: Use As Is Rework Repair Scrap Replace

Technical Contact Approval: _____

Title: _____ **Date:** _____

Buyer Approval: _____

Title: _____ **Date:** _____

Major Tool Implemented By: _____

Title: _____ **Date:** _____

Nonconformance Report: NC 19767

The port 15 a and b is out of positional tolerance.

The port 15a checks 1.148 position and the face runs out from -0.413 / -0.327.

The port 15b checks 0.747 position and the face runs out from -0.172 / -0.108.

Project Disposition:

Accept as is.

Approvals:

Procurement Technical Representative

Responsible Line Manager: