
Customer: ENERGY INDUSTRIES OF OHIO

Contact: NANCY HORTON
E-Mail: NKHFlowen@aol.com

Telephone: 216-496-2314
Fax: 216-328-2001

Part: SE141-116 / MODULAR COIL WINDING FORM TYPE

Drawing ID: 65707-3 XRAY MAP Revision: --

Customer P.O.: S005242-F/Ln:3
Serial No./Qty: C3

Reported By: MIKE GRIFFITH
E-Mail: mGriffith@MajorTool.com

Telephone: 317-636-6433
Fax: 317-634-9420

Problem: X-RAY FAILURE ON;
FLANGE 1, VIEW 0-1, POROSITY, MORE THAN 10 INDICATIONS EXCEEDING .080".
FLANGE 2, VIEW 0-1, POROSITY, MORE THAN 20 INDICATIONS EXCEEDING .080".

THIS REJECTION REPORT IS A SUMMARY OF DEFECTS THAT WERE DETECTED AS A RESULT OF
THE X-RAY REQUIREMENT FROM THE DISPOSITION OF NC18776.

Proposed Disposition:

RECOMMEND TO USE AS IS.

Number of additional pages: X-RAY MAP AND READER SHEET ATTACHED.

Customer Disposition: Use As Is Rework Repair Scrap Replace

A conference call was held between MTM, PPPL, and ORNL on February 21 to review these indications. Based on these discussions, we agree with the proposed disposition to use as is.

Major Tool Implemented By: _____ Title: _____ Date: _____

Technical Contact Approval:

RLM Approval: