
Customer: ENERGY INDUSTRIES OF OHIO

Contact: NANCY HORTON
E-Mail: NKHFlowen@aol.com

Telephone: 216-496-2314
Fax: 216-328-2001

Part: SE141-115 / MODULAR COIL, TYPE B

Drawing ID: SE141-115 Revision: 8
W/O Links: 1-Type:W: 65708/1.0 Sub: 1

Customer P.O.: S005242-F/Ln:1
Serial No./Qty: B1

Reported By: MIKE GRIFFITH
E-Mail: mGriffith@MajorTool.com

Telephone: 317-636-6433
Fax: 317-634-9420

Problem: INSPECT WELD UPGRADE AREA OF LEAD BLOCK PAD. 4 LINEAR INDICATIONS IN WELD AREA.
1. BOTTOM CORNER NEXT TO BOTL HOLE, .200", LINEAR
2. BOTTOM CENTER NEXT TO BOLT HOLE, .100", LINEAR
3. TOP CORNER NEXT TO BOLT HOLE, .200", LINEAR
4. TOP CENTER NEXT TO BOLT HOLE, .200" LINEAR
(LINEAR INDICATIONS DO NOT BREAK INTO BOLT HOLES)
5. 6 RANDOM ROUNDED INDICATIONS ARE ACCEPTABLE PER CUSTOMER REQUIREMENTS. PART IS REJECTED FOR THE 4 LINEAR INDICATIONS PER ASTM A903/A903M LEVEL 1.

Proposed Disposition:

MTM proposes that the indications be accepted as is.

Number of additional pages: none

Customer Disposition: Use As Is Rework Repair Scrap Replace

Tech Rep Approval: _____ Date: _____

RLM Approval: _____ Date: _____

Major Tool Implemented By: _____ **Title:** _____ **Date:** _____