PPPL NONCONFORMANCE REPORT NO: 3638 Open Date 03/20/06 Status 9 - Closed NCR 06-Workmanship/Needs Repair Trend Department **NCSX** Division NCSX Project Source/Org VENDOR Item Dwg/Part# Header Bracket Weldment Procurement # PE006421-W Cost Center RAP# 3236 Vendor ZENEX PRECISION PRODUCTS Job Doc # PE006421-W RAP Title NCSX Heating and Cooling Manifolds HoldTag Applied Nonconforming Condition (include requirement(s) violated): All 24 Header Bracket Standoff Weldments (Dwgs. SE123-168, Part 1) arrived with the throats of the fillet welds undersized by over 10 percent of the weld length as required per AWS D1.6, 6.28.1.7. Additionally, 13 of 24 Weldments have fillet welds that are excessively undercut beyond the limit set in AWS D1.6, 6.28.1.5. Sample Size Insp 24 24 Lot Rejected # Rejected Lot Size Recd 24 Validated Date 03/17/06 Reported By Boscoe J Validated By Zatz I Disposition: Rework*__ Repair*__ Use As Is*__ Return To Vendor* Scrap* Rework Return to vendor to reweld fillet. For rework or repair of vendor supplied equipments, fill in information below: Distribution Cog Dudek L \$G&A #Hours \$Est Labor Insp Boscoe J \$Burden \$Material \$Total Proj. Doc Control (when closed) Date 03/28/06 QC Files Disposition By Dudek L Malsbury J 03/28/06 Date Supervisor's Concur Williams M Boscoe J 03/28/06 Nelson B Date Eng. Dept. Head Concur Williams M Goranson P WCO/Other Date N/A Viola M Williams M White A Lumberger i PQA/QC Mgr Dispos Concur Date Malsbury J 03/28/06 Tyrrell M Malinowski F QC Field Verification By Date 05/05/06 Boscoe J