



Coil Clamp Concern (NCR 3642)



Insufficient thread engagement between the plug and clamp

Coil Clamp Concern



Additional G-11 pad required