PPPL NONCON										
	5 - Corrective	Action Needed		Trend	05-De	sign Interfe	rance			
_	NCSX			Division	NCSX	Project				
_	/ENDOR									
Item Dwg/Part# N	MCWF C-1, 2, a	and 3	Procurement	# S0052	242-F		Cost	Center	9450 1**	1404
RAP# 3209	Job Doc #	S005242-F	Vend	or Energy li	ndustries	of Ohio				
RAP Title NCSX - N	Modular Coil W	/inding Forms								
📃 HoldTag App	lied									
Nonconforming MCWFs 1,2, and 3 - W interfere with the flang or even insertion of the	Vhile the mode ge counter-bor	el shows adequate red holes in some	locations. In a	nominal wall t t least 4 case	hickness s, the lac	ck of clearar				
Lot Size Recd	0	Sample Size	Insp 0	_ 6	Lot	Rejected	ŧ	# Reject	ted	0
Reported By Get	ttelfinger G	Valid	ated By Ma	linowski F		Valid	ated	Date	03/27/06	
		Vana	<u></u>					-		
Disposition: Rewo This condition is cause machining. In some c	ed by the cast	air* Use As	s Is* Ret	urn To Ven s provided by	the foun	Scrap* dry to assur	re that t	there is su		
Disposition: Rewo	ed by the casi cases, the amo he design. MT	air* Use As ting "stocking" (ov punt of stocking ex rM has made a ga	s Is* Ret vercast) which is xceeds what is auge to check fo	urn To Ven s provided by allowed. In ge r adequate bo	the foun eneral the	Scrap* dry to assur e stocking a	re that t Illowand	there is si ce was no	ufficient ma ot taken int	0
Disposition: Rewo This condition is cause machining. In some c consideration during th	ed by the cast cases, the amo he design. MT n this gauge.	air* Use As ting "stocking" (ov punt of stocking ex rM has made a ga PPL will have to c	s Is* Ret vercast) which is xceeds what is auge to check fo do similarly for N	urn To Ven s provided by allowed. In ge r adequate bo ICWFs 1, 2, a	the foun eneral the olt cleara nd 3.	Scrap* dry to assur e stocking a nces o C4 a	re that t Illowand	there is si ce was nc ond. The	ufficient ma ot taken int	0
Disposition: Rewo This condition is cause machining. In some c consideration during th as necessary based or For rework or repa	ed by the cast cases, the amo he design. MT in this gauge.	air* Use As ting "stocking" (ov punt of stocking ex rM has made a ga PPL will have to c PPL will have to c	s Is* Ret vercast) which is acceeds what is auge to check fo do similarly for M	urn To Ven s provided by allowed. In ge r adequate bo ICWFs 1, 2, a ICWFs 1, 2, a	the foun eneral the olt cleara nd 3.	Scrap* dry to assur e stocking a nces o C4 a	re that t Illowand	there is su ce was no ond. The Distri	ufficient ma ot taken int y grind cle	arances
Disposition: Rewo This condition is cause machining. In some c consideration during th as necessary based of	ed by the cast cases, the amo he design. MT n this gauge.	air* Use As ting "stocking" (ov punt of stocking ex rM has made a ga PPL will have to c	s Is* Ret vercast) which is xceeds what is auge to check fo do similarly for N	urn To Ven s provided by allowed. In ge r adequate bo ICWFs 1, 2, a	the foun eneral the olt cleara nd 3.	Scrap* dry to assur e stocking a nces o C4 a	re that t Illowand	Distri Cog I Insp (Proj. Doc	ufficient ma ot taken int y grind cle bution	eder P ski J
Disposition: Rewo This condition is cause machining. In some c consideration during th as necessary based or For rework or repa #Hours	ed by the cast cases, the amo he design. MT in this gauge.	air* Use As ting "stocking" (ov punt of stocking ex rM has made a ga PPL will have to o PPL will have to o set the store of the store set the store of the stor	ipments, fill	urn To Ven s provided by allowed. In ge r adequate bo ICWFs 1, 2, a ICWFs 1, 2, a	the foun eneral the olt cleara ind 3.	Scrap* dry to assur e stocking a nces o C4 a	re that t Illowand	Distri Cog <u>I</u> Insp <u>(</u> Proj. Doc closed) QC Files	ufficient ma ot taken int y grind cle <u>b u t i o n</u> <u>Heitzenro</u> <u>Chrzanow</u> c Control (N	eder P ski J
Disposition: Rewo This condition is cause machining. In some c consideration during th as necessary based or For rework or repa #Hours \$Material	air of vendo	air* Use As ting "stocking" (ov punt of stocking ex rM has made a ga PPL will have to o PPL will have to o \$Est Labor \$Burden	ipments, fill	urn To Ven s provided by allowed. In ge r adequate bo ICWFs 1, 2, a ICWFs 1, 2, a	the foun eneral the olt cleara and 3.	Scrap* dry to assure stocking a nces o C4 a	re that t Illowand	Distri Cog I Insp (Proj. Doc closed) QC Files Malsburg	ufficient ma ot taken int y grind cle <u>bution</u> <u>Heitzenro</u> <u>Chrzanow</u> c Control (v	eder P ski J
Disposition: Rewo This condition is cause machining. In some c consideration during th as necessary based of For rework or repa #Hours \$Material Disposition By Supervisor's Cond	air of vendo	air* Use As ting "stocking" (ov punt of stocking ex TM has made a ga PPL will have to o PPL will have to o set Labor Burden <u>Heitzenroeder F</u>	ipments, fill	urn To Ven s provided by allowed. In ge r adequate bo ICWFs 1, 2, a ICWFs 1, 2, a	the foun eneral the olt cleara and 3.	Scrap* dry to assure stocking a nces o C4 a	re that t Illowand	Distri Cog <u>I</u> Insp <u>(</u> Proj. Doc closed) QC Files	ufficient ma ot taken int y grind cle <u>bution</u> <u>Heitzenro</u> <u>Chrzanow</u> c Control (v y J J	eder P ski J
Disposition: Rewo This condition is cause machining. In some c consideration during th as necessary based or For rework or repa #Hours \$Material Disposition By	air of vendo	air* Use As ting "stocking" (ov punt of stocking ex TM has made a ga PPL will have to c set the store of the store set the store of the sto	ipments, fill	urn To Ven s provided by allowed. In ge r adequate bo ICWFs 1, 2, a ICWFs 1, 2, a	the foun eneral the olt cleara and 3.	Scrap* dry to assure stocking a nces o C4 a 00/28/06 03/29/06	re that t Illowand	Distri Cog I Insp (Proj. Doc closed) QC Files Malsbury Boscoe	ufficient ma ot taken int y grind cle <u>bution</u> <u>Heitzenro</u> <u>Chrzanow</u> c Control (v y J J o n W	eder P ski J