	•	E REPORT	NO.	3696	Open L	atc	01/29/07			
Status	5 - Corrective Action Needed				Trend	01-De	01-Deviation From Doc/Proc			
Department					Division	WBS	114			
Source/Org	VENDOR									
Item Dwg/Part#	D-NCSX-MCF-00	1 Rev. 03	Procure	ement #	S00524	S005242-F Cost		Cost Cente	9450 1*** 1404	
RAP# 3209	_ Job Doc #	S005242-F		Vendor	Energy In	dustries	of Ohio			
RAP Title NCSX	Modular Coil Wi	nding Forms								
☐ HoldTag App	olied									
Nonconforming (Condition (inc	lude require	ment(s) v	iolated)	<u>:</u>					
found to exhibit a m relative magnetic pe	agnetic permeab rmeability of any	ility above the point in the wi	maximum a inding form	allowed. n (includir	NCSX-CSPE ng base met	C-141-(al and \)3-11 paragi weld repairs)	raph 3.1.1.5.1) shall not exc	ceed 1.02 Mu."	
Four tooling ball inse 1.02 Mu.	erts were left in t	he casting from	the vendo	or, these i	inserts are a	bove th	ne maximum	n magnetic pe	rmeability allowed of	
Representative pictu	res are attached									
Lot Size Recd _ Reported By P	0 helps C	Sample Size	Insp _	0 <u>Malin</u>	 owski F	Lot R	ejected Valid	# Reje lated Date	o1/29/07	
Disposition: Rewo	rk* Repair*	Use As Is*	Return 1	To Vendo	or* Scrap)*			Rework	
work. 2) Remove the four	tooling ball inser	is.								
For rework or repai	r of vendor sup	olied equipme	nts, fill in i	informati	on below:			Distr	<u>ibution</u>	
#Hours		\$Est Labor		\$	G&A			Cog		
\$Material		\$Burden		<u> </u>	Total		_	,	Doc Control (when	
Disposition By		Chrzanowski J				Date	01/31/07	close QC F		
0								Malck	iles	
Supervisor's Cor	ncur	Dudek L				Date	04/09/07		iles oury J	
•	ā					Date Date	04/09/07 04/09/07	Bosco	iles oury J	
Supervisor's Cor Eng. Dept. Head WCO/Other	Concur	Williams M	١					Bosco Chrza Sutto	illes oury J oe J anowski J n L	
Eng. Dept. Head	Concur)			Date	04/09/07	Bosco Chrza Sutto Malin	iles oury J oe J anowski J	