
Customer: PRINCETON PLASMA PHYSICS LAB

Contact: Mike Viola
E-Mail: mviola@pppl.gov

Telephone: 609-243-3655
Fax: 609-243-2021

Part: /

Drawing ID: SE121-014

Revision: 1C

Customer P.O.: S005243-F/Ln:3
Serial No./Qty: Lot 3 / 1 Pc

Reported By: DOUG MCCORKLE
E-Mail: dMcCorkle@MajorTool.com

Telephone: 317-636-6433
Fax: 317-634-9420

Problem: The profile of the spacer is out of tolerance. the profile checks from -0.145 / +0.266. The area that is out of tolerance is about a 12" long area on the top flange side profile. Refer to attached graphical report.

Proposed Disposition:

SUBMITTING TO PPPL FOR REMEDIAL DISPOSITION

Number of additional pages: 1

Customer Disposition: Use As Is Rework Repair Scrap Replace

Technical Contact Approval: _____

Title: _____ **Date:** _____

Buyer Approval: _____

Title: _____ **Date:** _____

Major Tool Implemented By: _____

Title: _____ **Date:** _____

Nonconformance Report: Major Tool NC20353

This is for: **VVSA # 3 Profile** SE121-014

Problem:

The profile of the spacer is out of tolerance. the profile checks from -0.145 / +0.266. The area that is out of tolerance is about a 12" long area on the top flange side profile. Refer to attached graphical report.
See attached ncr20353attach.xls

MTM Recommended Disposition:

None

Project Disposition:

Use as is.

Approvals:

Procurement Technical Representative

Responsible Line Manager: