

---

**Customer: ENERGY INDUSTRIES OF OHIO**

Contact: NANCY HORTON  
E-Mail: NKHFlowen@aol.com

Telephone: 216-496-2314  
Fax: 216-328-2001

**Part: SE141-116 / MODULAR COIL WINDING FORM TYPE**

Drawing ID: SE141-103                      Revision: 3

Customer P.O.: S005242-F/Ln:3  
Serial No./Qty: C3

Reported By: MIKE GRIFFITH  
E-Mail: mGriffith@MajorTool.com

Telephone: 317-636-6433  
Fax: 317-634-9420

Problem: Tool Marks,Gouge,s and Blended Area,s on T Section

- #1 .700" L x .100" W x .004" D
- #2 .700" L x .400" W x .012" D
- #3 .300" L x .150" W x .014" D
- #4 1.5" L x .150" W x .080" D
- #5 1.0" L x .150" W x .060" D

#6 Step at outer surface Datum E flange adjacent to poloidal break  
1.950" L x 1.300" W x .225 D SEE ATTACHMENT

---

**Proposed Disposition:**

PROPOSE TO USE AS IS.

---

Number of additional pages: 9 pictures

---

**Customer Disposition:**     Use As Is     Rework     Repair     Scrap     Replace

MTM notes that corrective actions have been taken to avoid the large step mistakenly machined at location six shown in the attached photos.

Major Tool Implemented By: \_\_\_\_\_ Title: \_\_\_\_\_ Date: \_\_\_\_\_

Accepted by:

Tech. Rep.

RLM









