PPPL NONCONFORMANCE REPORT NO: 3779 Open Date 09/26/08								
Status	2 - Disposition Needed		Trend	01-Deviation From Doc/Proc				
Department	NCSX		Division	Construction				
Source/Org	Fab, Ops and Maint							
Item Dwg/Part#	A2/B2/C2 Coil Assembly Procurement # D-NCSX-FPA-002							
Cost Center	WBS/	Other WBS 185						
<b>RAP#</b> 331	7 Job Doc # D-NCS	SX-FPA-002 Ven	dor					
RAP Title Field Period Assembly Station Two								
HoldTag Applied								

## Nonconforming Condition (include requirement(s) violated):

1) Step 9.1.13 of FPA-002 requires measurement of all monuments after torquing of "super-nuts". A and B monuments are required to be within .015" of their desired position. One monument measures .019". The component of the deviations of monuments on the C Coil, that is normal to the flange faces shall be <.010". Two monuments measure .012" and .014".

2) Step 9.1.22 of FPA-002 requires measuring the C Coil nose shims after welding. RMS deviation is required to be less than or equal to .004". Actual RMS deviation is .006".

3) Step 9.1.40 of FPA-002 requires measuring the position of all monuments within .020" of the desired position. One monument measures .021".

Lot Size Recd 0	Sample Size Insp	0 Lot Rejecte	d #Rejected 0
Reported By Ellis R	Validated By	Boscoe J	Validated Date 09/26/08
Distribution Cog	M. Viola	Insp <u>J. Boscoe</u>	
Proj. Doc Control (when c	closed) QC Files	Malsbury J	Boscoe J
J. Edwards L. Dudek Heitzenroeder P Tyrrel	Ellis R Brooks A Williams M I M Simmons R	Chrzanowski J	

Disposition:	Rework	Repair	Use As Is	Return to Vendor	Scrap
For rework or	repair of vend	lor supplied e	quipment, fill in	information below:	
# Hours \$ Est Labor \$ G&A					
\$ Mate	rial	\$ Burden		\$ Total	
Disposition b	У				
RLM Concurr	ence				
Eng. Dept. He	ad Concurren	ce			
Other (i.e., W	CO/FPE) Conc	urrence		N/A	
PQA/QC Mgr	Disposition Co	oncurrence			
QA Field Veri	fication by				
					p. 2