

# National Compact Stellarator Experiment (NCSX)

**DRAFT**

## Statement of Work

Vacuum Vessel Sub Assembly (VVSA) Fabrication

NCSX-SOW-121-03-00-dE

**April 23, 2004**

**Prepared by:**

\_\_\_\_\_  
M. Viola, Technical Representative for WBS 12 Procurements

**Concurrences:**

\_\_\_\_\_  
P. Goranson, Vacuum Vessel (WBS 12) Manager

\_\_\_\_\_  
B. Nelson, Project Engineer for Stellarator Core Systems (WBS 1)

\_\_\_\_\_  
F. Malinowski, PPPL Procurement QA Representative

**Approved by:**

\_\_\_\_\_  
W. Reiersen, Engineering Manager

**DRAFT**

### **Controlled Document**

*This is a controlled document. Check the NCSX Manufacturing Web Page at [http://www.pppl.gov/me/NCSX\\_MFG/](http://www.pppl.gov/me/NCSX_MFG/) prior to use to assure that this document is current*

## Revisions

Revision No.	Description of Change	Date
Rev. 0	All	

# Table of Contents

<b>1</b>	<b>GENERAL INFORMATION.....</b>	<b>1</b>
1.1	INTRODUCTION .....	1
1.2	BACKGROUND .....	1
1.3	SCOPE .....	3
<b>2</b>	<b>APPLICABLE DOCUMENTS.....</b>	<b>3</b>
2.1	PRODUCT SPECIFICATION .....	3
2.2	SUPPLIER DOCUMENTS .....	3
<b>3</b>	<b>WORK REQUIREMENTS.....</b>	<b>4</b>
<b>4</b>	<b>QUALITY ASSURANCE .....</b>	<b>4</b>
4.1	INSPECTION/ SURVEILLANCE/AUDIT BY PPPL.....	4
4.2	SUBCONTRACTOR'S RESPONSIBILITY FOR CONFORMANCE .....	4
4.3	NONCONFORMING ITEMS .....	5
4.4	DEVIATIONS TO THE APPROVED MANUFACTURING INSPECTION TEST / QA PLAN OR PROCEDURES .....	5
4.5	SUBCONTRACTOR'S QUALITY ASSURANCE PROGRAM .....	5
4.6	INSPECTION AND TEST PROCEDURES .....	5
4.7	DOCUMENT TRACEABILITY AND RECORDS.....	6
4.8	EQUIPMENT/MATERIAL IDENTIFICATION AND STATUS .....	6
4.9	CALIBRATION OF TEST AND MEASURING EQUIPMENT .....	6
4.10	CONTROL OF SPECIAL PROCESSES .....	6
4.11	PPPL RECEIVING AND INSPECTION.....	6
<b>5</b>	<b>DELIVERABLES .....</b>	<b>7</b>
5.1	WEEKLY REPORTS .....	7
5.2	MONTHLY REPORTS .....	7
5.3	VACUUM VESSEL SUBASSEMBLIES .....	7
5.3.1	Shipping Release Form .....	7
5.3.2	Process History.....	8
5.4	TOOLING.....	8

## List of Figures

Figure 1 - The NCSX device and definition of its major components .....	2
Figure 2 - NCSX with all components removed except the vacuum vessel and its ports .....	2
Figure 3 - Vacuum Vessel Sub-Assembly (VVSA) Components .....	3

# 1 GENERAL INFORMATION

## 1.1 Introduction

This Statement of Work is for the manufacturing of three (3) Vacuum Vessel Sub-Assemblies (VVSA's) including associated port extensions and spacer assemblies, which are critical components for the National Compact Stellarator Experiment (NCSX). The VVSA's, fabricated of N06625 material, are toroidal (donut-shaped) in major diameter, but highly shaped in the poloidal (short) direction. Three (3) 120° VVSA's comprise the complete NCSX vacuum vessel. Each VVSA includes a field period assembly (the basic vacuum vessel shell), associated port extensions (including blank off flanges, seals, and fasteners) and one connecting spacer assembly.

NCSX is the first of a new class of stellarators known as "compact stellarators." Stellarators are a class of magnetic fusion confinement devices characterized by three-dimensional magnetic fields and plasma shapes and are the best-developed class of magnetic fusion devices after the tokamak. The stellarator concept has greatly advanced since its invention by Dr. Lyman Spitzer, the founding director of the Princeton Plasma Physics Laboratory (PPPL), during the 1950's. A traditional stellarator uses only external magnetic fields to shape and confine the plasma. The differentiating feature of a compact stellarator is the use of plasma current in combination with external fields to accomplish plasma shaping and confinement. This combination permits a more compact stellarator design.

The NCSX project is managed by PPPL in partnership with the Oak Ridge National Laboratory. This Subcontract will be administered by PPPL. Operation of NCSX is scheduled to begin in May 2008. Further description of the NCSX can be found at <http://ncsx.pppl.gov/>.

## 1.2 Background

Figure 1 is a sectional view of the NCSX device showing its major components. Note in particular the vacuum vessel, which is the subject of this Statement of Work. In Figure 2, all but the vacuum vessel and its ports are removed from this drawing so the vessel and its ports can be clearly viewed. Note the symmetry in the vessel. It is comprised of 3 identical 120° vessel segments in the toroidal direction. Furthermore, shows that each segment is symmetric around its vertical midplane – the right 60° half segment is identical to the left half segment, but is inverted. Consequently, the vessel consists of six identical half segments. shows the three ports which will be installed by the supplier. The remainder will be fabricated by the supplier, shipped separately, and field installed at PPPL by PPPL; this is necessary to allow assembly of the other

machine components around the vessel. The figures below are representative and are only for illustration; they should not be used in the performance of this Scope of Work.

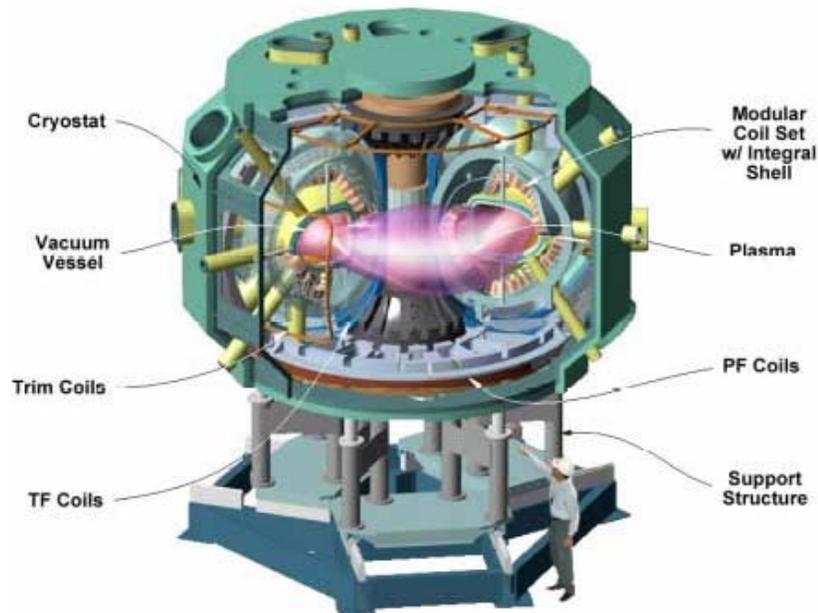


Figure 1 - The NCSX device and definition of its major components

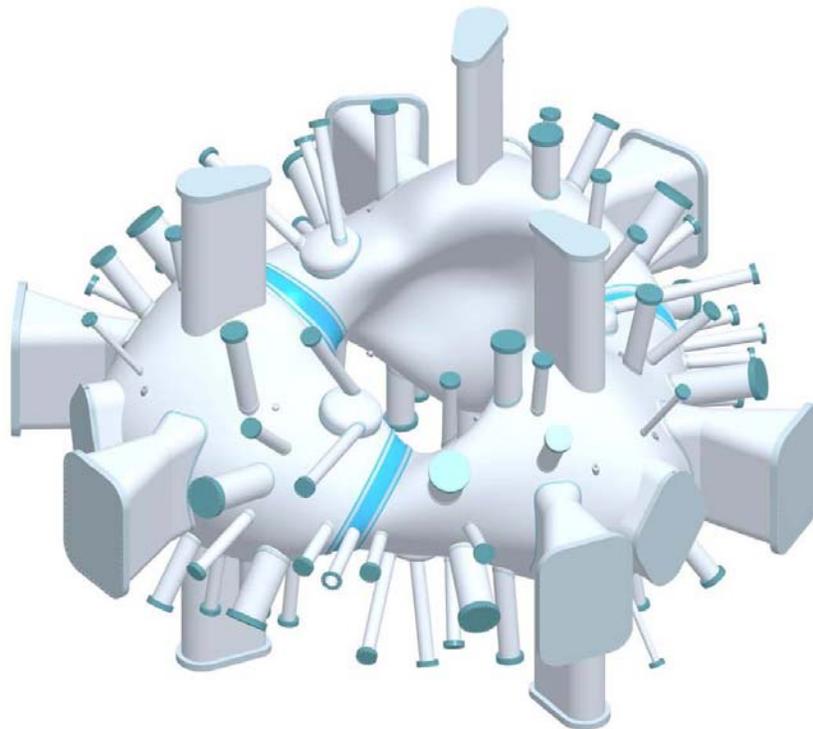
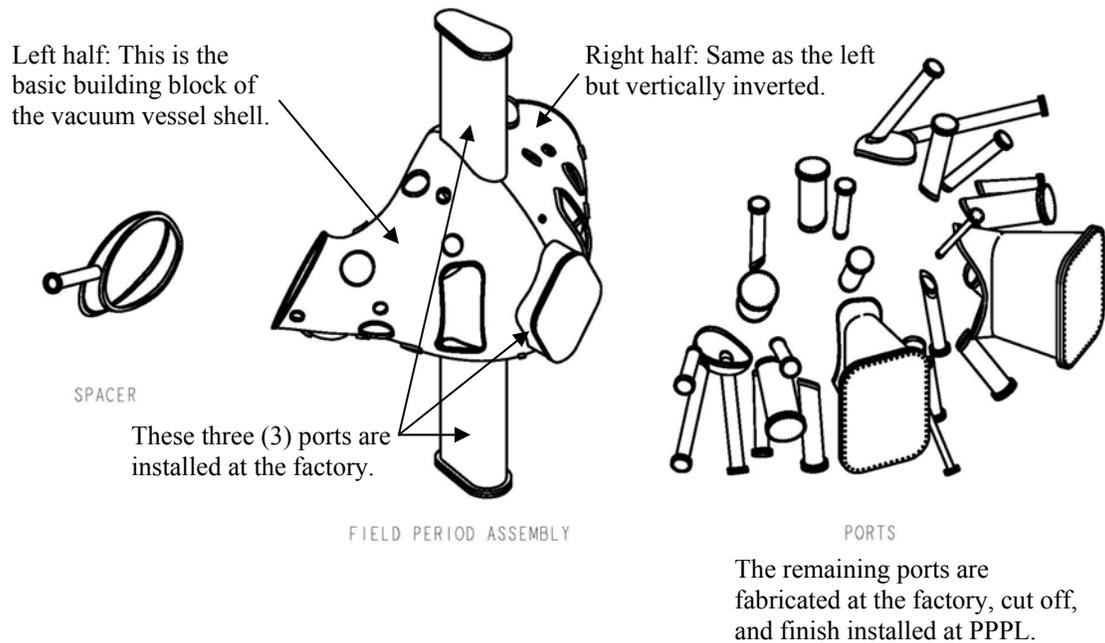


Figure 2 - NCSX with all components removed except the vacuum vessel and its ports



**Figure 3 - Vacuum Vessel Sub-Assembly (VVSA) Components**

### 1.3 Scope

This SOW defines the production of the three Vacuum Vessel Sub-Assemblies (VVSA's) each consisting of a field period assembly, the associated port extensions and a connecting spacer assembly. The VVSA is defined in product specification NCSX-CSPEC-121-02.

The due dates for all deliverables are defined in the Subcontract.

## 2 APPLICABLE DOCUMENTS

### 2.1 Product Specification

The applicable version of the product specification NCSX-CSPEC-121-02 and can be found at:

< [http://www.pppl.gov/me/NCSX\\_MFG/](http://www.pppl.gov/me/NCSX_MFG/) >

### 2.2 Supplier Documents

The supplier provided document shall include PPPL-approved Manufacturing, Inspection, Test Plan/Quality Assurance (MIT/QA) Plan and associated procedures.

### **3 WORK REQUIREMENTS**

The supplier shall manufacture, inspect, test and deliver to PPPL three (3) VVSA's that conform to the applicable version of the product specification, the, supplier's PPPL-approved MIT/QA Plan, and associated procedures. Supplier shall provide all process documentation identified in Section 5 of this SOW.

### **4 QUALITY ASSURANCE**

#### **4.1 INSPECTION/ SURVEILLANCE/AUDIT BY PPPL**

Authorized representatives of PPPL and the U. S. Government shall have the right at all reasonable times to visit the Subcontractor's premises and those of Subcontractor's suppliers during the performance of the Subcontract for the purposes of inspection, surveillance, audit and/or obtaining any required information as may be necessary to assure that items or services are being furnished in accordance with specified requirements. Such visits shall be coordinated with the Subcontractor's personnel to minimize interference with the normal operations of said premises. The Subcontractor shall make available records and documentation necessary for this function and shall provide all reasonable facilities and assistance for the safety and convenience of PPPL and/or U. S. Government representatives in the performance of their duties. PPPL and the U. S. Government recognize the Subcontractor's right to withhold information concerning proprietary processes. The Subcontractor agrees to insert the paragraph above in each lower-tier procurement issued hereunder.

#### **4.2 SUBCONTRACTOR'S RESPONSIBILITY FOR CONFORMANCE**

Neither PPPL review and/or approval of Subcontractor's documents nor PPPL inspection of Subcontractor's items or services shall relieve the Subcontractor of responsibility for full compliance with requirements of the Subcontract. The Subcontractor is responsible for assuring that all requirements and restrictions are imposed on any sub-tier suppliers.

#### **4.3 NONCONFORMING ITEMS**

Nonconforming items shall be positively identified, and, where possible, segregated to prevent use. PPPL must be notified of nonconformances within one (1) business day. The Subcontractor shall document each nonconformance, identifying the extent and location of the nonconformance and proposing a disposition. The written concurrence of PPPL is required prior to implementing the disposition. The Subcontractor's system shall provide not only for timely resolution of nonconformances but also for analysis of nonconformances to determine root causes and to implement appropriate and effective corrective actions.

#### **4.4 DEVIATIONS TO THE APPROVED MANUFACTURING INSPECTION TEST / QA PLAN OR PROCEDURES**

Deviations to the approved documents shall be included in the weekly report. The Subcontractor is required to obtain PPPL's written approval for deviations which may adversely affect conformance to the contracted delivery schedule or product specification.

#### **4.5 SUBCONTRACTOR'S QUALITY ASSURANCE PROGRAM**

The Subcontractor shall maintain an effective Quality Assurance Program to assure that the Subcontractor's work meets the required quality and is performed in accordance with contractual requirements. Subcontractor's quality assurance function shall be actively involved in the planning, processing oversight, problem resolution, and determination of acceptability of all work under this SOW. The function shall be organized to have sufficient authority and independence to identify quality problems, verify conformance of supplied items or services to specified requirements and obtain satisfactory resolution of conflicts involving quality.

#### **4.6 INSPECTION AND TEST PROCEDURES**

Inspections and tests shall be performed in accordance with written procedures referencing criteria for acceptance or rejection. Except where specifically stated otherwise, actual data and accept/reject status for each inspection and test shall be documented.

#### **4.7 DOCUMENT TRACEABILITY AND RECORDS**

The Subcontractor shall maintain a system of documentation whereby objective evidence of required operations, inspections, examinations, and tests is systematically compiled, indexed, stored and ultimately provided to PPPL per paragraph 5.3.2. Such objective evidence may include "travelers"; and material test, certification, inspection, examination, test and nonconformance reports; which shall be complete, legible, and validated by responsible personnel and shall be traceable to subject items.

#### **4.8 EQUIPMENT/MATERIAL IDENTIFICATION AND STATUS**

Material and equipment identification shall be maintained throughout the program and be traceable to records. Status of acceptability shall be readily discernible through the Subcontractor's use of tags, stamps, serial numbers or other positive means.

#### **4.9 CALIBRATION OF TEST AND MEASURING EQUIPMENT**

Inspections and tests shall be performed using properly calibrated measuring and test equipment. Subcontractor shall have in its possession the necessary equipment to perform the required inspections and tests. Calibration standards shall be traceable to the National Institute for Standards and Technology (NIST) or equivalent acceptable to PPPL and shall not be used for shop inspections, but instead be protected against damage or degradation.

#### **4.10 CONTROL OF SPECIAL PROCESSES**

Subcontractor shall use trained and qualified personnel and qualified written procedures in accordance with specified requirements for the performance of certain special processes, including but not limited to, welding, dimensional inspection, heat treatment, nondestructive examination, etc. Copies of special process procedures and personnel qualifications shall be submitted to PPPL for review and approval a minimum of five working days prior to performance of the work.

#### **4.11 PPPL RECEIVING AND INSPECTION**

PPPL will perform Receiving Inspection on items supplied by Subcontractor.

## **5 DELIVERABLES**

### **5.1 WEEKLY REPORTS**

Brief weekly status reports covering technical, administrative, and quality activities and notable problems/issues and progress photographs. Periodically, when requested by the Princeton Technical Representative, the report will include the percent completion of the work for the next milestone deliverable.

### **5.2 MONTHLY REPORTS**

The Subcontractor shall prepare and submit monthly e-mail reports indicating schedule progress for each task/deliverable planned.

- The Subcontractor shall submit a milestone schedule that clearly indicates the tasks to be accomplished, the time frame over which each task will be accomplished, and the cost assigned to that task.
- The Subcontractor shall report (e-mail report satisfactory) schedule progress against each milestone by indicating actual and forecast finish dates. A narrative explanation of schedule delays shall also be provided.

### **5.3 VACUUM VESSEL SUBASSEMBLIES**

Provide three (3) completed VVSA's per the requirements contained in the product specification (NCSX-CSPEC-121-02).

#### **5.3.1 Shipping Release Form**

Prior to shipment of VVSA components, the Subcontractor must have submitted to PPPL a completed and signed "Product Quality Certification and Shipping Release" form (Attachment 1 of this SOW), along with a copy of the process history (ref. Paragraph 5.3.2), and received from PPPL written acceptance to ship.

### 5.3.2 **Process History**

Subcontractor shall provide to PPPL one (1) "paper" copy or one (1) "electronic" copy of the Process History, which includes a compilation of documents, detailing the objective evidence of the acceptability of the work performed. The Process History shall be complete and available at the time the Subcontractor requests Release for Shipment. The Process History shall include as a minimum, but not be limited to:

- Signed Shipping Release
- Validated inspection and test reports, including radiographs
- Material certifications
- Completed nonconformance reports
- Heat treatment charts
- Welding procedures and procedure qualification test records
- Personnel qualifications for Special Processes (Non Destructive Examination, welding, etc.)
- Completed shop travelers or process sheets

### 5.4 **TOOLING**

All tooling specially fabricated for the performance of this SOW shall become the property of the United States Government. Disposition will be per direction of PPPL.

**ATTACHMENT 1**

PRINCETON UNIVERSITY  
 PLASMA PHYSIC LABORATORY—PPPL

PRODUCT QUALITY CERTIFICATION AND SHIPPING RELEASE					
PROJECT	ITEM DESCRIPTION			SHIPMENT NUMBER	
PPPL Subcontract / Order No.	REV.	ITEM NO.	SUBCONTRACTOR REFERENCE NO.	REV.	QUANTITY SHIPPED
<p><b>SUBCONTRACTOR'S CERTIFICATION</b></p> <p>This is to certify that the products and services identified herein have been produced under a controlled quality assurance program and are in conformance with the procurement requirements including applicable codes, standards and specifications as identified in the above-referenced documents unless noted below. Any supporting documentation will be retained in accordance with the procurement requirements.</p> <p>SIGNED: _____ DATE: _____</p> <p>TITLE: _____ COMPANY: _____</p>					
<p><b>PPPL (AUTHORIZED REPRESENTATIVE) SHIPPING RELEASE</b></p> <p>This is to certify that evidence supporting the above Subcontractor's Certification statement has been audited and no product/service nonconformances from procurement requirements have been found unless noted below. This product/service is hereby released for shipment.</p> <p>This section serves as the Quality Assurance release for the above described product for shipment. It does not constitute an acceptance thereof and does not relieve the Vendor, Manufacturer or Subcontractor of any and all responsibility or obligation imposed by the purchase contract. It does not waive any rights the Purchaser may have under the purchase contract, including the Purchaser's right to reject the above described material upon discovery of any deviations from requirements of the purchase contract, drawings and specifications.</p>					
<p><b>NONCONFORMANCES FROM PROCUREMENT QUALITY REQUIREMENTS:</b></p>					
<p><b>REMARKS/PRODUCT SERIAL NUMBERS:</b></p>					
<p>BY PPPL QA REPRESENTATIVE (OR DESIGNEE)</p>				<p>DATE</p>	